🖸 simex

1.5 Intended use

SIMEX Ltd., Wielopole 11, 80-556 Gda sk, Poland, tel. (+48) 58 762-07-77, www.simex.pl

Operating manual

Plug-On Display SWE-430L



CE

Version: SWE-430L_INSSXEN_v.1.00.000

Table of contents

- 1. General information
- 2. Product identification
- 3. Mechanical installation
- 4. Electrical Installation
- 6. Operation
- 7. Placing out of service
- 8. Maintenance
- 9. Return
- 10. Disposal
- 11. Warranty conditions
- 12. Declaration of conformity

1. General information

1.1 Information on the operating manual

This operating manual contains important information on proper usage of the device. Read this operating manual carefully before installing and starting up the pressure measuring device.

Adhere to the safety notes and operating instructions which are given in the operating manual. Additionally applicable regulations regarding occupational safety, accident prevention as well as national installation standards and engineering rules must be complied with!

This operating manual is part of the device, must be kept nearest its location, always accessible to all employees.

This operating manual is copyrighted. The contents of this operating manual reflect the version available at the time of printing. It has been issued to our best knowledge. However, errors may have occurred. Simex is not liable for any incorrect statements and their e ects.

- Technical modifications reserved -

1.2 Symbols used

- ▲ DANGER! Dangerous situation, which may result in serious or fatal injuries
- MARNING! Potentially dangerous situation, which may result in fatal or serious injuries
- ▲ CAUTION! Potentially dangerous situation, which may result in minor injuries
- ! CAUTION! Potentially dangerous situation, which may result in damage of objects
- IST NOTE Tips and information for the user to ensure good conditions for the operation.

1.3 Target group

A WARNING! To avoid operator hazards and damages of the device, the following instructions have to be worked out by qualified technical personnel.

1.4 Limitation of liability

By non-observance of the operating manual, inappropriate use, modification or damage, no liability is assumed and warranty claims will be excluded. The plug-on display SWE-430L has been designed to equipe transmitters with analog output 4...20 mA (2-wire) or 0...10 V / 3-wire (pressure, temperature etc.) with a digital display. Additional up to 2 PNP open collector contacts for a limiting value control can be offered. The plugon display has to be installed between male and female plug and is ready for work immediately. A preferred area of use is e.g. on-site process monitoring.

- It is the operator's responsibility to check and verify the suitability of the device for the intended application. If any doubts remain, please contact our sales department in order to ensure proper usage. Manufacturer is not liable for any incorrect selections and their e ects!
- The technical data listed in the current data sheet are engaging and must be complied with. If the data sheet is not available, please order or download it from our homepage. (http://www.simex.pl)
- WARNING! Danger through improper usage!

1.6 Package contents

- Please verify that all listed parts are undamaged included in the delivery and check for consistency specified in your order:
 - plug-on display SWE-430L
 - only with plug ISO 4400: profile seal, fastening screw
 - sheet of labels
 mounting instructions

1.7 UL – Approval (for devices with UL-identification)

The UL – Approval was done with respect to U.S. standards norms which also correspond with the applicable Canadian standards norms for safety.

Note the following points, so that devices fulfils the demands of UL approval: - The transmitter shall be supplied by Limited Energy

- Source (per UL 61010) or NEC Class 2 Power Source.
- maximum operating voltage: see technical data

2. Product identification

The device can be identified by its manufacturing label. It provides the most important data. By the ordering code the product can be clearly identified. The programme version of the firmware, (e. g. P07) will appear for about 1 second in the display after starting up the device. Please hold it ready for inquiry calls.

| typ input designa | | ordering code | serial- number | |
|------------------------------------------------|---------------------------|-----------------------------------------|--------------------------------------|----------------|
| G simex | SIMEX Sp. Poland, tel. | z o.o., 80-556 Gd . (+48 58) 762-07- | a sk, ul. Wieloj 77, www.simex | pole 11 .pl |
| SWE-430L | 850-1-1 | -100-1-1-000 | SN: 229 | 2090 |
| Input: 4 20mA Output: 4 20m Supply Vs 6V | nA/2wire | | <u>°inout:</u> /s-:2 3hield:⊥_ | CE |
| | | / | | |

output connector pinout

Fig. 1 manufacturing label- example

! The manufacturing label must not be removed from the device!

3. Mechanical installation

- 3.1 Mounting and safety instructions
- WARNING! Install the device only when currentless!
 WARNING! This device may only be installed by qualified
- technical personnel who has read and understood the operating manual! ! Handle this high-sensitive electronic precision measuring
- device with care, both in packed and unpacked condition!
- ! There are no modifications/changes to be made on the device.
- ! Do not throw the package/device!
- ! Remove packaging only directly before starting up the device to avoid any damage!
- ! Do not use any force when installing the device to prevent damage of the device and the transmitter!
- ! The display and the plastic housing are equipped with re tational limiters. Please do only rotate the display or the housing within the limit.

3.2 General installation steps

- Carefully remove the pressure measuring device from the package and dispose of the package properly.
- Remove the cable socket or mating plug from the trans-

3.3 Installation steps for Binder and M12x1

- Plug the display onto the transmitter.
 - Plug the cable socket or mating plug onto the transmitter and fasten it properly.

3.4 Installation steps for ISO 4400

- Plug the display onto the transmitter. Take care that the pre-mounted seal on the bottom fits correctly.
- Remove the fastening screw from the cable socket.
- Replace the pre-assembled profile seal of the cable socket with the delivered seal to ensure an ingress protection of IP 65.
- Plug the cable socket onto the plug-on display.
- Place the delivered stainless steel screw through cable socket and plug-on display and tighten it to the transmit ter with a screwdriver.

3.5 Positioning of the display module

The display module is rotatable so that clear readability is guaranteed even on unusual installation positions. The display module can be turned as shown below.

 


Fig. 2 display module

4. Electrical Installation

- ▲ WARNING! Install the device only when currentless!
 ▲ The supply must correspond to the safety class II (protective insulation)!
- The transmitter shall be supplied by Limited Energy Source (per UL 61010) or NEC Class 2 Power Source! Establish the electrical connection of the device according to the technical data shown on the manufacturing label and the pin configuration and the respective wiring diagram below.

4.1 Pin configuration


| | Electrical connections | | | | | |
|-----------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------|----------------|----------------|-----------|--|--|
| | | M12x1 | Binder | Binder | | |
| | ISO 4400 | (5-pin), | 723 | 723 | | |
| | | metal | (5-pin) | (7-pin) 1 | | |
| Supply + | 1 | 1 | 3 | 3 | | |
| Supply - | 2 | 2 | 4 | 1 | | |
| 3-wire: Signal + | 2 3 ² 3 ² | 3 ² | 5 ¹ | - | | |
| Contact 1 | 3 ² | 5 | 2 | - | | |
| Contact 2 | - | 3 ² | 1 ¹ | - | | |
| Shield | ground | 4 | ground | 2 | | |
| | contact | 4 | contact | 2 | | |
| ¹ intended for usage with DMP 331i, DMP 333i and LMP 331i with el. connection Binder series 723 (7-pin); pins 4, 5, 6, 7 are | | | | | | |

wired through 1:1 ² pin configuration according to version

3


4.2 Wiring diagrams

 2-wire-system (current)



  $V_{S\mbox{ min}}$: minimum supply of the used 2-wire transmitter





 V_{TR} : supply of the used 3-wire transmitter

- ! For devices with cable socket, you have to make sure that the external diameter of the used cable is within the allowed clamping range. Moreover you have to ensure that it lies in the cable gland firmly and cleftlessly!
- Please note that the cable socket or mating plug has to be mounted properly to ensure the ingress protection mentioned in the data sheet.
- For the electrical connection a shielded and twisted multicore cable is recommended.

The supply created by the electronics of the plug-on display is

approx. 6 V_{DC}. Please take this into consideration when plan-

ning your power supply. The tolerances for the power supply

 $V_{TR min}$ = minimum supply of the used 2-wire transmitter

V_{TR max} = maximum supply of the used 2-wire transmitter

The minimum supply of the plug-on display ($V_{S min}$) is 8 V. The

mum supply of the transmitter must be used for the total ap-

pliance if it is higher than 8 V. The following formulas are valid:

 $V_{S min} = V_{TR min}$

 $V_{\text{TR\,min}}$ = minimum supply of the used 3-wire transmitter

The maximum supply of the plug-on display (V_{S max}) is 36 V.

As the connected transmitter is also supplied by the plug-on

display, the maximum supply does not only depend on the

supply of the SWE-430L. If the maximum supply of the trans-

mitter is lower than 36 V, the maximum supply of the total ap-

pliance may not exceed the transmitter's value. The following

 $V_{Smax} = 36 V$

 $V_{S max} = V_{TR max}$

 $V_{TR max}$ = maximum supply of the used 3-wire transmitter

A WARNING! Before start-up, the user has to check for

▲ WARNING! The device can be started and operated by authorized personnel only, who have read and under-

A WARNING! The device has to be used within the technical specifications, only (compare the data in the data

I FD

-button

The device has, according to the order max, 2 LEDs which are

allocated to the resp. contacts. The LEDs will light up when

the respective set point has been reached and the contact is

active. The display of the measured value as well as the con-

figuration of the individual parameters occurs menu-driven via

The menu system is a closed system allowing you to scroll both forward and backward through the individual set-up

menus to navigate to the desired setting item. All settings are

permanently stored in an EEPROM and therefore available

again even after disconnecting from the supply voltage. The

structure of the menu system is the same for all types of de

vices, regardless of the number of contacts. However, they

only di er by the number of menus. Following figure and the

R Please follow the manual meticulously and remember

that changes of the adjustable parameters (switch-on point, switch-o point, etc.) become only e ective after pushing both buttons simultaneously and leaving the

contact 2

4-digit seven- seg-

ment display

proper installation and for any visible defects

stood the operating manual

6.1 Operating and display elements

unit

 \odot

Fig. 3 touchpad for device with two contacts

-button

the seven-segment display.

menu list shows all possible menus.

6.2 Configuration

V_{S min} = 8 V

connected transmitter is supplied by the SWE-430L, so the mini-

4.3 Supply of 2-wire-systems

can be calculated as follows

4.4 Supply of 3-wire-systems

minimum supply:

if V_{TR min} 8 V:

if VTR min < 8 V:

maximum supply

formulas are valid.

if VTR max 36 V:

if VTP max < 36 V:

5. Initial start-up

sheet)!

6. Operation

LED

contact '

minimum supply: $V_{S \min} = V_{TR \min} + 6 V$

maximum supply: $V_{S max} = V_{TR max} + 6 V$

To avoid a configuration by unauthorized persons, the possibility is given to lock the device by an access protection. More information is given in menu 1 of the menu list.

6.3 Password system

of the enclosed unit labels.

Fig. 4 compare mode

inverted

Fig. 6 hysteresis mode

6.4 Unit

The unit of the values to be measured is determined on ordering. But it is also possible to change the unit later by using one

6.5 Description of hysteresis and compare mode

To invert the respective modes, you have to exchange the values for the switch-on and switch-o points.



 


Fig. 5 compare mode

 

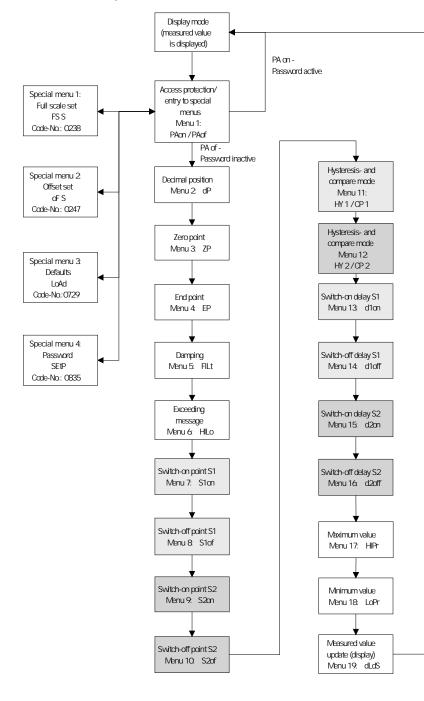

6.7 Menu list

- -button: move in the menu system (forward) or increase the displayed value; it will also lead you to the operating mode (beginning with menu 1)
- -button: move in the menu system (backward) or decrease the displayed value; it will also lead you to the operating mode (beginning with the last menu)
- both buttons simultaneously: confirm the menu items and set values
- F to increase the counting speed, when setting the values: keeping the respective button pushed for more than 5 seconds

Execution of configuration:

- set the desired menu item by pushing the or -button activate the set menu item by pushing both buttons simultaneously
- set the desired value or select one of the o ered settings by using the or -button
- store the set value / selected setting and exit the menu by pushing both buttons simultaneously menu 1 - access protection 'Hon PAon password active to deactivate: set password
- PRoF PAof password inactive to activate: set password Constraint setting for the password is "0005"; modification of the password is described in special menu 4 menu 2 – set decimal point position menus 3 and 4 - set zero point / end point the device has been configured correctly before delivery, so a later setting of a 2-wire device is only necessary, if ≣þ. a di ering displayed value is desired (e. g. 0 ... 100 %) menu 5 – set damping -ILE this function allows getting a constant display value although the measuring values may vary considerably; the tim constant for a simulated low-pass filter can be set (0.3 up to 30 sec permissible) menu 6 – exceeding message set "on" or "o " HLO menus 7 - set switch -on point S lon set the values, for the activation of contact 1 (S1on) menus 8 - set switch -o point S IoP set the values, for the deactivation of contact 1 (S1oF) menus 9 - select hysteresis or compare mode
- select hysteresis mode (HY 1) or compare mode (CP 1) for contact 1 Compare "7.4 Description of hysteresis and compare mode" menus 10 - set switch -on delay d lon set the value of the switch-on delay after reaching contact 1 (d1on) (0 up to 100 sec permissible) menus 11 - set switch -o delay d laF set the value of the delay after reaching switch-of point 1 (d1of) (0 up to 100 sec permissible) menus 12 and 13 - maximum / minimum value display view high pressure (HIPr) or low pressure (LoPr) during the measurement process (the value will not remain stored if the power supply is interrupted) IS to erase: push both buttons again within one second menu 14 – measured value update (display) dLdS. set the length of the update cycles for the display (0.0 up to 10 sec permissible) special menus (to access a special menu, select the menu item "PAof" with the or -button and confirm it; "1" appears in the display) special menu 1 – full scale compensation for full scale compensation, which is necessary if the indicated value for full scale differs from the real full scale FS S value in the application: a compensation is only possible with a respective reference source, if the deviation of the measured value is within defined limits; set "0238"; confirm with both buttons; "FS S" will appear in the display; now it is necessary to place the device under pressure (the pressure must correspond to the end point of the pres sure measuring range); push both buttons, to store the signal being emitted from the pressure switch as full scale, in the display the set end point will appear although the full scale sensor signal is displaced. Is the analogue output signal (for devices with analogue output) is not a ected by this change special menu 2 - o set compensation / position correction oF 5. set "0247";confirm menu item; if o set ambient pressure it is necessary to place the device under pressure (pres sure reference has to corresponding to the zero point of the pressure measuring range); push both buttons to store the signal being emitted from the pressure switch as o set; in the display the set zero point will appear although the sensor signal in the o set is displaced IS a position correction is necessary, if the installation position di ers from the calibration position (otherwise this can cause a little deviation of the signal, which gives a wrong value indication)
 - In the analogue output signal (for devices with analogue output) is not a ected by this change; when displacing the o set, the full scale will also be displaced

special menu 3 - load defaults _oRd

set "0729; to load the defaults, push both buttons simultaneously IS any changes carried out will be reset (password will be set on "0005")

special menu 4 – set password

SEEP set "0835"; confirm with both buttons; "SEtP" appears in the display; set the password using the - or -button .. 9999 are permissible, the code numbers 0238, 0247, 0729, 0835 are exempt); confirm the password by push ing both buttons simultaneously

7. Placing out of service

- be done in the depressurized and currentless condition! Check also if the medium has to be drained o before dismantling!
- A WARNING! Depending on the medium, it may cause danger for the user. Comply therefore with adequate precautions for purification.

8. Maintenance

In principle, this device is maintenance-free. If desired, the housing of the device can be cleaned when switched of using a damp cloth and non-aggressive cleaning solutions.

9. Return

Before every return of your device, whether for recalibration. decalcification, modifications or repair, it has to be cleaned carefully and packed shatter-proofed. You have to enclose a notice of return with detailed defect description when sending the device. If your device came in contact with harmful substances a declaration of decontamination is additionally required. Appropriate forms can be downloaded from our homepage www.simex.pl. Should you dispatch a device without a declaration of decontamination and if there are any doubts in our service department regarding the used medium, repair will not be started until an acceptable declaration is sent

 ${ig \Delta}$ If the device came in contact with hazardous substances, certain precautions have to be complied with for purification!

10. Disposal

The device must be disposed of according to the European Directive 2012/19/EU (waste electrical and electronic equipment). Waste of electronic equipment must not be disposed of in household wastel

A WARNING! Depending on the measuring medium, deposit on the device may cause danger for the user and the environment. Comply with adequate precautions for purification and dispose of it properly.

11. Warranty conditions

The warranty conditions are subject to the legal warranty period of 24 months from the date of delivery. In case of improper use, modifications of or damages to the device, we do not accept warranty claims. Damaged diaphragms will also not be accepted. Furthermore, defects due to normal wear are not subject to warranty services.

12. Declaration of conformity / CE

The delivered device fulfils all legal requirements. The applied directives, harmonised standards and documents are listed in the EC declaration of conformity, which is available online at http://www.simex.pl Additionally, the operational safety is confirmed by the CE sign on the manufacturing label.

A WARNING! When dismantling the device, it must always

